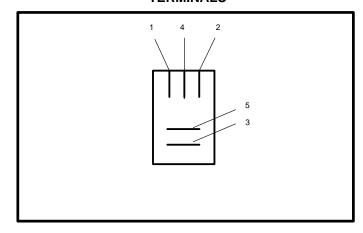## COMPONENT TESTING PROCEDURE

Connect Battery Positive and Negative to Terminals:	Check Continuity from Terminals:	Continuity will be:
1 and 2	3 to 4 and 3 to 5	From 3 to 5 only
–	1 to all others	To 2 only
–	3 to all others	To 4 only

TERMINALS

SCHEMATIC

RELAY CONTACTS CHANGE POSITION WITH CURRENT THROUGH COIL