
TERMINALS

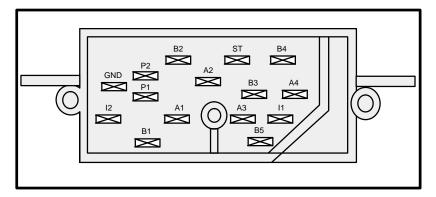

COMPONENT TESTING PROCEDURE

TO TEST	Connect Self- Powered Test Light or Ohmmeter to Terminals	Move Key to These Positions	A Good Switch Will Indicate
Starter Relay Circuit	B4 and ST	Acc, Lock, Off, Run, Start	Closed Circuit in Start Position only
Ignition Coil Circuit	B5 and I1	Acc, Lock, Off, Run, Start	Closed Circuit in Start and Run Positions only
Acc Power Circuit	B5 and A1	Acc, Lock, Off, Run, Start	Closed Circuit in Acc Position only
	B1 and A1	Acc, Lock, Off, Run, Start	Closed Circuit in Run Position only
Run Power Circuit	B3 and A3	Acc, Lock, Off, Run, Start	Closed Circuit in Run Position only
	B4 and A4	Acc, Lock, Off, Run, Start	Closed Circuit in Run Position only
Body Builder Prove-Out Circuit	P2 and GND	Acc, Lock, Off, Run, Start	Closed Circuit in Start Position only
Bulb Prove-Out Circuit	GND and P1	Acc, Lock, Off, Run, Start	Closed Circuit in Start Position only